# ROWLINSON® GARDEN PRODUCTS

# **Premium Heritage Double Log Store**

**Assembly Instructions** 

### Before assembly

- We recommend that time is taken to read the instructions before starting assembly, then follow the easy step by step guide. The instruction sheet is only a guide to the assembly. Certain items may not be shown to scale.
- Check all components prior to assembly
- This product should be assembled by no less than two people
- Drill all components where indicated





### Recommended tools for assembly


- Power Drill/Screwdriver
- · Cross-head drill bit
- 3mm diameter drill bit
- Tape measure
- Spirit level


#### Biocidal Products Regulation EU 528/2012

Wolmanie CX treated wood, is a treated article incorporating biocidal products: copper hydroxide carbonate, bis(N-cyclohexyl-diazenium-dioxy)-copper and Boric Acid. They protect wood against fungal decay, rot and insect attack. Wear gloves when handling freshly treated wood. Avoid breathing dust when cutting wood. Dispose of off-cuts responsibly.

| No. | Components                        | Qty. |
|-----|-----------------------------------|------|
| ı   | Front side upright (1428mm)       | 2    |
| 2   | Rear side upright (1670mm)        | 2    |
| 3   | Front centre upright (1400mm)     | 1    |
| 4   | Rear centre upright (1642mm)      | - 1  |
| 5   | Side panel                        | 2    |
| 6   | Back panel                        | 2    |
| 7   | Centre support rail               | 2    |
| 8   | Short shelf support (45x28x470mm) | - 1  |
| 9   | Long shelf support (45x28x810mm)  | 1    |
| 10  | Floor/Shelf                       | 3    |
| П   | Roof rear strip (16x45x1020mm)    | 2    |
| 12  | Roof panel                        | 2    |
| 13  | Fascia arch                       | 2    |
| 14  | Fascia support block (28x28x95mm) | 4    |
| 15  | Floor/Shelf fascia (21x70x880mm)  | 3    |
| 16  | Bargeboards                       | 2    |
| 17  | Finial                            | I    |

| No. | Fixing Kit      | Qty. |
|-----|-----------------|------|
| 18  | Metal L-bracket | 4    |
| 19  | 60mm Screw      | 32   |
| 20  | 50mm Screw      | 30   |
| 21  | 40mm Screw      | 45   |
| 22  | 32mm Screw      | 32   |

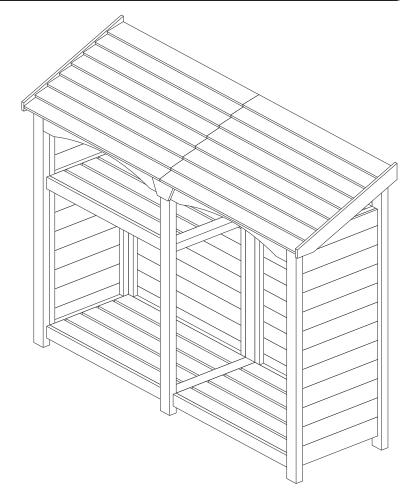


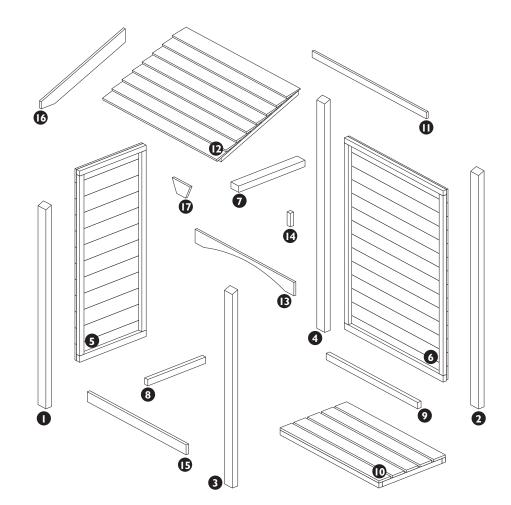


# 1. Side panels and uprights

| No. | Components for this section | Qty. |  |
|-----|-----------------------------|------|--|
| - 1 | Front upright (1428mm)      | 2    |  |
| 2   | Rear upright (1670mm)       | 2    |  |
| 5   | Side panel                  | 2    |  |


|    | Fixings for this section |    |
|----|--------------------------|----|
| 19 | 60mm screws              | 12 |
| 17 | bullill screws           | 1. |

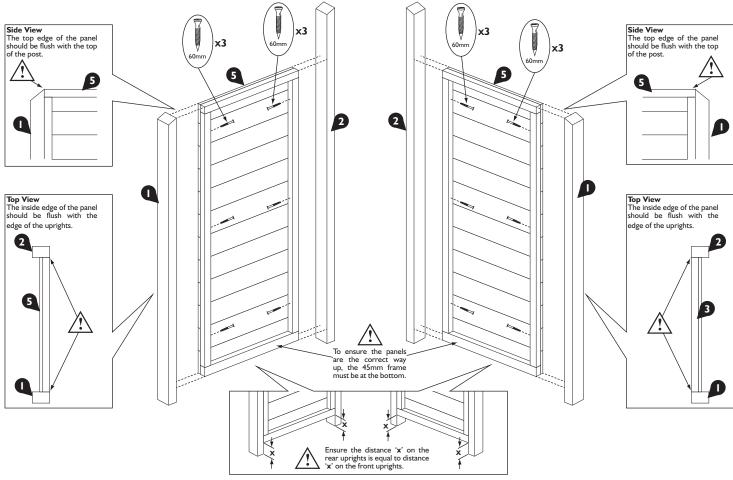

# 2. Back Panels

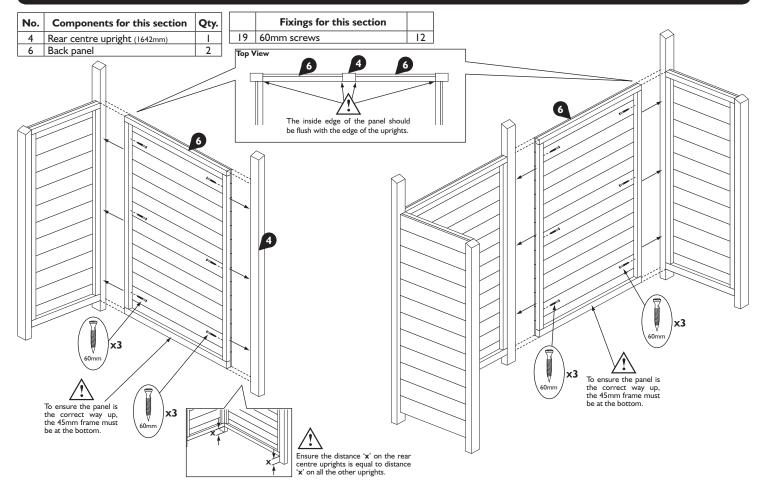



# 3. Shelf Support Rails



21

Fixings for this section The shelf can be set at any height and on either side of the log store. Theses instructions show the shelf being fitted to the left-hand side. To fit to the right-hand side, the shelf support rails (8,9) to the right-hand, back and side panels. 18 Metal L-bracket 40mm screws 6

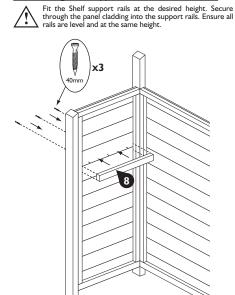


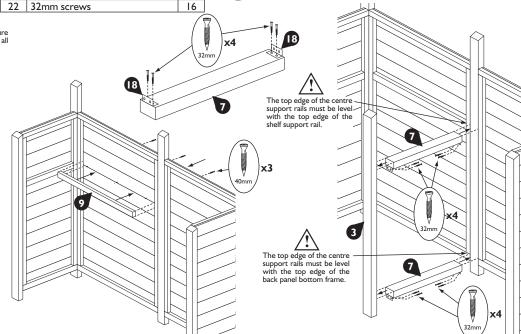


# 4. Floor & Shelf

| No. | Components for this section      | Qty. |
|-----|----------------------------------|------|
| 10  | Floor/Shelf                      | 3    |
| 15  | Floor/Shelf fascia (21x70x880mm) | 3    |


|    | Fixings for this section |    |
|----|--------------------------|----|
| 20 | 50mm screws              | 30 |
| 21 | 40mm screws              | 9  |

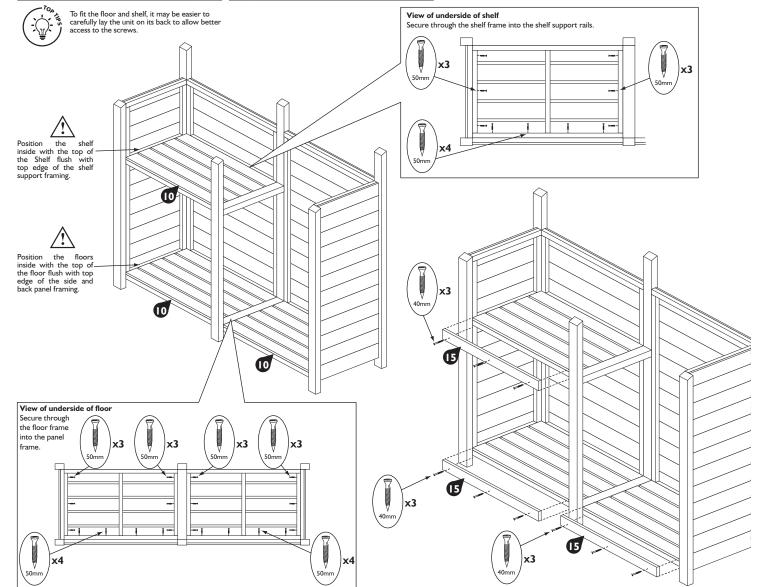

## 5. Fascia Arch

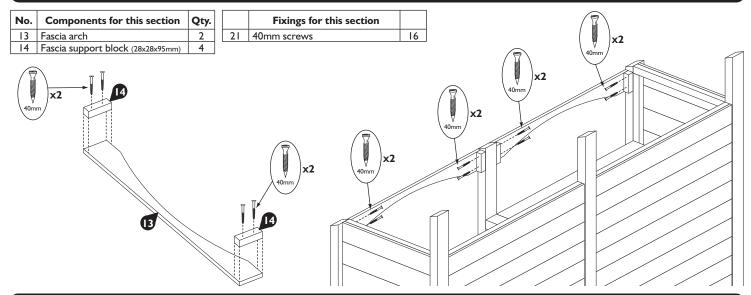

# 6. Roof & Bargeboards

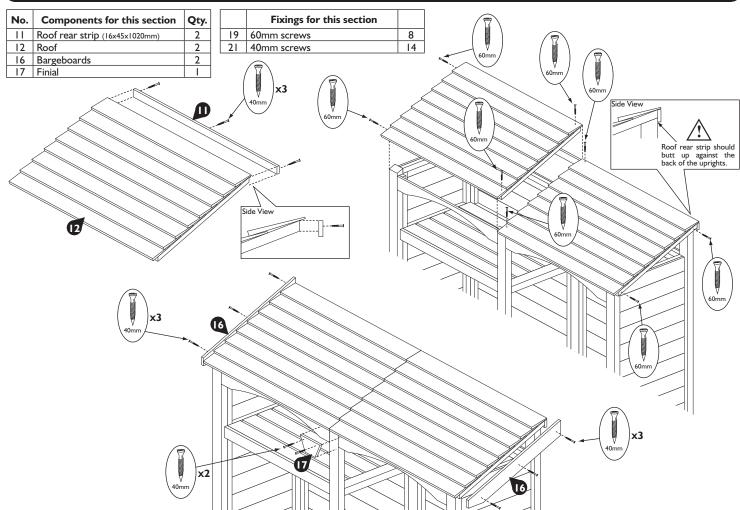

# Important information - retain for future reference

Pressure treated buildings require no further preservative treatment, However they can be painted or stained if required.

Timber Information.

As timber is a natural material, there are certain weather conditions that may affect the materials properties. In times of excessive dry spells the material may lose some of its internal moisture causing a certain degree of shrinkage on a panel and in periods of excessive rain there will be a certain amount of swelling throughout the wooden panels. This process can not be avoided. If you have problems with certain boards shrinking in dry spells try to decrease the amount of direct sunlight on the building or the amount of air passing over the building.

If in doubt of any aspect regarding the assembly, use or safety of your Log Store please contact us:

# Help Line: (Normal Office Hours) 01829 261 121

# Email: support@rowgar.co.uk

ROWLINSON GARDEN PRODUCTS LIMITED Green Lane Wardle Nr. Nantwich Cheshire CW5 6BN www.rowgar.co.uk We constantly improve the quality of our products, occasionally the components may differ from the components shown and are only correct at time of printing. We reserve the right to change the specification of our products without prior notice.