Alliance Remedial Supplies Ltd

Units 11 & 12 Regents Trade Park Barwell Lane Gosport Hampshire PO13 OEQ

Tel: 01329 235252

e-mail: info@allianceremedialsupplies.co.uk website: www.allianceremedialsupplies.co.uk



Agrément Certificate
16/5313
Product Sheet 1

DRYFIX DAMP-PROOF SYSTEMS

DRYFIX INJECTION CREAM

This Agrément Certificate Product Sheet^[1] relates to DryFix Injection Cream, a concentrated silane/siloxane emulsion cream for insertion into mortar courses to form a remedial damp-proof course (dpc) in existing walls, and the associated replastering.

(1) Hereinafter referred to as 'Certificate'.

CERTIFICATION INCLUDES:

- factors relating to compliance with Building Regulations where applicable
- factors relating to additional non-regulatory information where applicable
- independently verified technical specification
- assessment criteria and technical investigations
- design considerations
- installation guidance
- regular surveillance of production
- formal three-yearly review.

KEY FACTORS ASSESSED

Effectiveness against rising damp — when injected into suitable substrates in accordance with BS 6576 : 2005, the product forms an effective barrier against rising damp in existing walls (see section 6).

Drying time — after treatment, a 230 mm solid brick wall previously affected by rising damp should normally dry out in 6 to 12 months (see section 7).

Durability — the product will remain effective against rising damp for at least 20 years (see section 9).

The BBA has awarded this Certificate to the company named above for the product described herein. This product has been assessed by the BBA as being fit for its intended use provided it is installed, used and maintained as set out in this Certificate.

On behalf of the British Board of Agrément

Date of First issue: 21 October 2016

John Albon — Head of Approvals

Construction Products

Claire Curtis-Thomas

Carre.

Chief Executive

The BBA is a UKAS accredited certification body — Number 113. The schedule of the current scope of accreditation for product certification is available in pdf format via the UKAS link on the BBA website at www.bbacerts.co.uk

Readers are advised to check the validity and latest issue number of this Agrément Certificate by either referring to the BBA website or contacting the BBA direct.

British Board of Agrément Bucknalls Lane Watford Herts WD25 9BA tel: 01923 665300 fax: 01923 665301 clientservices@bba.star.co.uk www.bbacerts.co.uk

Regulations

The Building Regulations 2010 (England and Wales) (as amended)



In the opinion of the BBA, the use of DryFix Injection Cream in an existing building is not subject to these Regulations, but action to satisfy Requirement C2(a) and Regulation 7 may be necessary for a 'Material change of use' as defined in Regulation 5(a) (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Requirement: C2(a) Resistance to moisture

The product satisfies the BBA rising damp test and adequately resists the passage of moisture. See Comment:

section 6 of this Certificate.

Regulation: Materials and workmanship

The product is acceptable. See section 9 and the Installation part of this Certificate. Comment:

The Building (Scotland) Regulations 2004 (as amended)



In the opinion of the BBA, the use of DryFix Injection Cream in an existing building is not controlled by these Regulations, but action to satisfy the Regulation and related Mandatory Standards below may be necessary for a 'Conversion' as defined in Regulation 4 of these Regulations (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Regulation: Durability, workmanship and fitness of materials

The product can contribute to a construction satisfying this Regulation. See section 9 and the Installation Comment:

part of this Certificate

Regulation: 9 Building standards applicable to construction

3.3 Flooding and ground water Standard: Standard: 3.4 Moisture from the ground

The product satisfies the BBA rising damp test and adequately resists the passage of moisture and can Comment:

contribute to satisfying these Standards, with reference to clauses 3.3.1(1)(2), 3.4.1(1)(2) and 3.4.5(1)(2). See

section 6 of this Certificate.

Statement of sustainability

The product can contribute to meeting the relevant Requirements of Regulation 9, Standards 1 to 6 Comment:

and therefore will contribute to a construction meeting a bronze level of sustainability as defined in this

12 Building standards applicable to conversions Regulation:

All comments given for the product under Regulation 9, Standards 1 to 6 also apply to this Regulation, Comment:

with reference to clause 0.12.1(1)(2) and Schedule 6(1)(2).

Technical Handbook (Domestic). (2) Technical Handbook (Non-Domestic)

The Building Regulations (Northern Ireland) 2012 (as amended)



In the opinion of the BBA, the use of DryFix Injection Cream in an existing building is not controlled by these Regulations, but action to satisfy Regulations 23(a)(b)(i) and 28(a) may be necessary for a `Material change of use' as defined in Regulation 8 (the presence of a UK map indicates that the subject is related to the Building Regulations in the region or regions of the UK depicted):

Fitness of materials and workmanship 23(a)(b)(i) Regulation:

The product is acceptable. See section 9 and the Installation part of this Certificate. Comment:

Regulation: 28(a) Resistance to moisture and weather

The product satisfies the BBA rising damp test and adequately resists the passage of moisture. See section Comment:

6 of this Certificate

Construction (Design and Management) Regulations 2015

Construction (Design and Management) Regulations (Northern Ireland) 2016

Information in this Certificate may assist the client, designer (including Principal Designer) and contractor (including Principal Contractor) to address their obligations under these Regulations.

3 Delivery and site handling (3.1 and 3.3) of this Certificate.

Additional Information

NHBC Standards 2016

NHBC accepts the use of DryFix Injection Cream, provided it is installed, used and maintained in accordance with this Certificate, in relation to NHBC Standards, Section 5.1 Substructure and ground floors.

Technical Specification

1 Description

DryFix Injection Cream is a ready-to-use silane/siloxane cream, used to form a barrier against rising damp where there is no dpc, or where the existing dpc has failed.

2 Manufacture

- 2.1 The product is manufactured in a controlled batch-blending process.
- 2.2 As part of the assessment and ongoing surveillance of product quality, the BBA has:
- agreed with the manufacturer the quality control procedures and product testing to be undertaken
- assessed and agreed the quality control operated over batches of incoming materials
- monitored the production process and verified that it is in accordance with the documented process
- evaluated the process for management of nonconformities
- checked that equipment has been properly tested and calibrated
- undertaken to carry out the above measures on a regular basis through a surveillance process, to verify that the specifications and quality control operated by the manufacturer are being maintained.

3 Delivery and site handling

- 3.1 DryFix Injection Cream is supplied in 380 ml plastic cartridges and 5 litre packs. Packaging bears the trade name and product description, company contact details, hazard labelling and the BBA logo.
- 3.2 The product should be stored in a cool, dry place and protected from frost.
- 3.3 The Certificate holder has taken the responsibility of classifying and labelling the product under the CLP Regulation (EC) No 1272/2008 on the classification, labelling and packaging of substances and mixtures. Users must refer to the relevant Safety Data Sheet(s).

Assessment and Technical Investigations

The following is a summary of the assessment and technical investigations carried out on DryFix Injection Cream.

Design Considerations

4 Use

- 4.1 DryFix Injection Cream is satisfactory for use to form a damp-proof course in accordance with BS 6576 : 2005 and the The Property Care Association Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls in existing:
- solid walls of brickwork, blockwork or masonry
- conventional cavity walls
- walls of rubble-filled construction.
- 4.2 The installation process involves delivering a set amount of the product into a series of holes drilled into the mortar course, and the subsequent replastering.
- 4.3 Replastering is necessary to retain the salts in the body of the wall and prevent damage to subsequent redecoration. This should be carried out in accordance with a BBA-approved replastering specification.
- 4.4 DryFix Injection Cream does not affect expanded polystyrene or bitumen.

5 Practicability of installation

The product should be installed by contractors with experience in the treatment of rising damp using the methods described in this Certificate.

6 Effectiveness against rising damp



When installed in the substrates defined in section 4.1, in accordance with BS 6576 : 2005, the product forms an effective barrier against rising damp.

7 Drying time

After treatment, a 230 mm thick solid brick wall previously affected by rising damp should normally dry out in 6 to 12 months, provided normal heating is used during the winter months. A thicker wall may take longer. Where hygroscopic salts are present the wall may not dry completely, but the replastering system will prevent damage to internal decorations.

8 Maintenance

The product does not require maintenance.

9 Durability



Excluding use in new repair work (where highly alkaline mortars are present), the process is expected to remain effective for at least 20 years.


Installation

10 General

- 10.1 Installation of DryFix Injection Cream is by applicator gun and must be carried out in accordance with BS 6576: 2005 and the requirements of The Property Care Association Code of Practice for Installation of Remedial Damp-proof Courses in Masonry Walls by the Certificate holder's approved installers.
- 10.2 The original survey may have identified other possible causes of dampness, and measures to rectify these must be taken as necessary.
- 10.3 To avoid split responsibility, any replastering carried out should be conducted by the installer or its approved agent.


11 Timber floor — inspection, preparation and repair

11.1 Where a suspended timber floor is independently supported on sleeper walls, with an effective dpc and showing no signs of dampness, these need not be treated (see Figure 1).

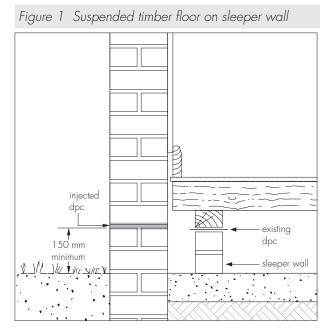


11.2 Where a suspended timber floor is supported on joists and/or a wall plate bearing on, or embedded in, the wall, there is a possibility of decay, particularly where concealed timbers are in contact with the damp wall. The condition of these timbers should be ascertained and remedial action taken if necessary (see Figure 2).

Figure 2 Check embedded timbers for decay

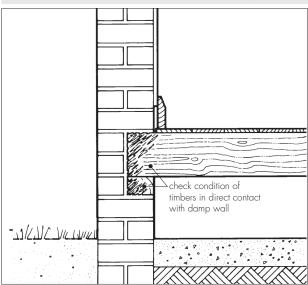


11.3 If damage is limited to the joist ends, the floors may be re-formed, using sleeper walls or joist-hangers, to isolate the timbers from the damp wall (see Figure 3).

Figure 3 Isolation of timber joists from damp wall

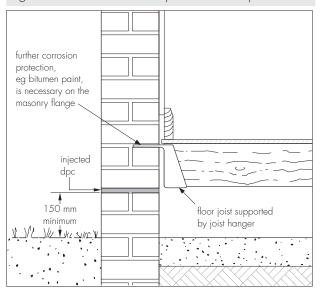

11.4 If the timbers are sound, the existing floor may be retained provided the injected dpc is formed below the timber joists and/or wall plate (see Figure 4).

Figure 4 Injection of dpc below wall plate

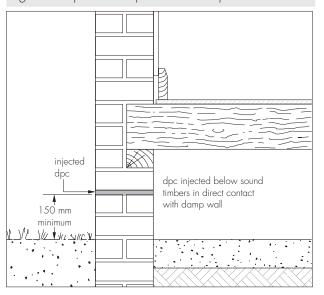

12 Preparation

- 12.1 The course to be injected is chosen so that the position of the horizontal dpc complies, as far as is practicable, with the recommendations of BS 6576: 2005, clause 8.3.
- 12.2 Internal walls on solid floors are treated as close to the floor as possible.
- 12.3 Complementary vertical dpc's are positioned, where necessary, to isolate treated walls from the effects of rising damp in adjoining walls or to maintain continuity between horizontal dpc's at different levels.
- 12.4 Internal skirting and flooring are removed, as necessary, to expose the area for treatment. Externally, the proposed dpc line is exposed, where necessary, by removing any facing material. Internal plastering which may be affected by hygroscopic salts is removed from the area to be treated to a height of at least 300 mm above the maximum level of the rising damp (subject to a 1 m minimum height).

13 Procedure

- 13.1 Holes 12 mm in diameter are drilled horizontally at the base of perpends and at maximum intervals of 120 mm along the selected mortar course.
- 13.2 Solid walls of brick or stone should be drilled from one side to within 20 mm of the opposite face. Where this is not possible advice should be sought from the Certificate holder.
- 13.3 For preference, cavity walls should be treated from both sides but, if the thickness of the individual leaves permits, may be treated from one side. When undertaking treatment from one side, the drill must pass completely through the selected mortar course, then across the cavity and to a depth of 90 mm in the other leaf. The cavity must be clear before treatment. When treating cavity walls from one side it is essential that the holes in each leaf are filled.
- 13.4 In random stone and rubble infill walls, the mortar course should, if possible, be followed at the appropriate selected level, or drillings may be made into porous stone. Where the variable thickness of stone walls and the possibility of rubble infill dropping and blocking injection holes cause difficulties, it may be necessary to drill to 50% of the wall thickness from both sides at a corresponding height. Alternatively, additional holes should be drilled adjacent to obstructed holes to ensure that an adequate volume of DryFix Injection Cream is introduced to the wall.
- 13.5 The injection process consists of loading the DryFix cartridge into the applicator gun and inserting the gun delivery tube into the full depth of the predrilled hole. Each hole is backfilled fully with DryFix to within 10 mm of the surface by slowly squeezing the gun trigger whilst withdrawing the delivery tube.
- 13.6 Particular care must be taken to avoid bridging the dpc, either internally or externally. Where external rendering has been removed, it must be restored, ending in a bell casting above the injected dpc.
- 13.7 Holes in the external wall surfaces are plugged with sand/cement mortar coloured to match the existing wall surface.
- 13.8 The treated walls are left for at least 14 days to allow initial drying out. Internal plastering is applied in accordance with a BBA-approved replastering specification.

Technical Investigations

14 Tests

Tests were carried out, and the results evaluated, to determine effectiveness against rising damp to a BBA method.

15 Investigations

- 15.1 The manufacturing process was evaluated, including the methods adopted for quality control, and details were obtained of the quality and composition of the materials used.
- 15.2 An assessment was made of existing data on the effectiveness of silicone-based products as a chemical dpc.
- 15.3 An assessment was made of data on the effectiveness and durability of similar materials used as external surface water repellents, and an assessment was made of the durability of the injection system.
- 15.4 An assessment was made of the materials available for replastering.

Bibliography

BS 6576 : 2005 Code of practice for diagnosis of rising damp in walls of buildings and installation of chemical damp-proof courses

BS EN ISO 9001: 2008 Quality management systems — Requirements

Conditions of Certification

16 Conditions

16.1 This Certificate:

- relates only to the product/system that is named and described on the front page
- is issued only to the company, firm, organisation or person named on the front page no other company, firm, organisation or person may hold or claim that this Certificate has been issued to them
- is valid only within the UK
- has to be read, considered and used as a whole document it may be misleading and will be incomplete to be selective
- is copyright of the BBA
- is subject to English Law.

16.2 Publications, documents, specifications, legislation, regulations, standards and the like referenced in this Certificate are those that were current and/or deemed relevant by the BBA at the date of issue or reissue of this Certificate.

16.3 This Certificate will remain valid for an unlimited period provided that the product/system and its manufacture and/or fabrication, including all related and relevant parts and processes thereof:

- are maintained at or above the levels which have been assessed and found to be satisfactory by the BBA
- continue to be checked as and when deemed appropriate by the BBA under arrangements that it will determine
- are reviewed by the BBA as and when it considers appropriate.

16.4 The BBA has used due skill, care and diligence in preparing this Certificate, but no warranty is provided.

16.5 In issuing this Certificate, the BBA is not responsible and is excluded from any liability to any company, firm, organisation or person, for any matters arising directly or indirectly from:

- the presence or absence of any patent, intellectual property or similar rights subsisting in the product/system or any other product/system
- the right of the Certificate holder to manufacture, supply, install, maintain or market the product/system
- actual installations of the product/system, including their nature, design, methods, performance, workmanship and maintenance
- any works and constructions in which the product/system is installed, including their nature, design, methods, performance, workmanship and maintenance
- any loss or damage, including personal injury, howsoever caused by the product/system, including its manufacture, supply, installation, use, maintenance and removal
- any claims by the manufacturer relating to CE marking.

16.6 Any information relating to the manufacture, supply, installation, use, maintenance and removal of this product/system which is contained or referred to in this Certificate is the minimum required to be met when the product/system is manufactured, supplied, installed, used, maintained and removed. It does not purport in any way to restate the requirements of the Health and Safety at Work etc. Act 1974, or of any other statutory, common law or other duty which may exist at the date of issue or reissue of this Certificate; nor is conformity with such information to be taken as satisfying the requirements of the 1974 Act or of any statutory, common law or other duty of care.